

Alaska Scientific Crime Detection Laboratory

DataMaster Check In Form

Effective: 10/10/2022

Version: 3.0

Instrument #: 100255

Received From: Intox

Date: 10/23/23

Analyst: Carlie Glaister

Reason for instrument return:

Returned from Intox. Was sent due to filter wheel issues.

Change instrument and case location in JusticeTrax Breath Alcohol Database

Ensure change in instrument status form is in JusticeTrax CUW 10/23/23

Upload No agency info to upload. modem did connect CUW 10/23/23

Update agency information and polling status in DMHost Calling Program

Check for VOCs CUW 10/23/23
No agency VOCs to check.

From Intoximeters

Intoximeters Repair Paperwork (attached) CKG 11/3/2023

100255 2022.07.11 Evaluation was marked as Further Evaluation Needed instead of Return to Factory. It was later decided to return 100255 to the factory along with a few other instruments that were having filter wheel issues. This instrument was sent to the factory on 06/29/2023.
CKG 11/3/2023

SRO Number: SRO-057721

Received Date: 07/05/2023

Completion Date: 10/02/2023

SRO Type: REPAIR

SRO Description: DMT Repair

Customer ID: C000003651

Customer PO: 07052023-OBryant

Contact: Colleen OBryant

Email: Colleen.obryant@alaska.gov

Ship To:

Alaska Scientific Crime Detection Laboratory
4805 Dr MLK Jr Ave
Anchorage AK 99507
USA

Units on SRO

1	97-1300-00	REFURB INTOX DMT
---	------------	------------------

Service Line: 1		**All Instruments are Calibrated to Factory Specifications**	
Unit Type:	(97-1300-00) REFURB INTOX DMT		
Serial Number:	50100255		
Reason:	DMT Status Messages		
	FitWl er		
Reason Notes:	Customer Reported Issue: Filter wheel issue		
Resolution:	Replaced		
	RPL comp		
Resolution Notes:	Replaced filter wheel solenoid. Replaced stepper motor pinion. Replaced latch screw for stepper motor clasp. Rebuilt filter wheel assembly. Performed filter wheel test, 30:0 pass.		
Parts:	<u>Qty</u>	<u>Part Number</u>	<u>Part Description</u>
	1	001020-00	DMT HRDW PEM NUT FLOATING 6-32 SS
Reason:	Preventive Maintenance		
	planned		
Reason Notes:	Preventative Maintenance		
Resolution:	Replaced		
	RPL mech		
Resolution Notes:	Replaced all tubing inside instrument. Replaced all teflon joints. Adjusted sidecar dry gas bed. Tanks now install with ease. Performed standard service and repair. Replaced pem nut/swage on sidecar chassis panel. Now threads.		
	1	99-0001-00	MISC REPAIR
	1	59-0080-00	DMT ELEC ASSY SOLENOID FILTR WHEEL 41344

Order Packing Slip Report

Intoximeters
Experience • Service • Integrity

10/11/2023 9:45:46 AM

Packing Slip: 292119

Pack Date: 10/11/2023

SRO: SRO-057721



From: Intoximeters, Inc
2081 Craig Road
St Louis MO 63146
USA

Customer: C000003651

Ship To: 1

Alaska Department of Public Safety
4805 Dr MLK Jr Ave
Anchorage AK 99507
USA

Alaska Scientific Crime Detection
Laboratory
4805 Dr MLK Jr Ave
Anchorage AK 99507
USA

Customer PO: 07052023-OBryant

Ship Via: FDX

FED EX

Weight: 38.00

Delivery Terms: 2D

Shipping Terms: ORIGIN

Packages: 1

Customer Ship Account:

Line Number	Item	UM	Ordered Quantity	Shipment Quantity	Backorder Quantity
1	97-1300-00	REFURB INTOX DMT			50100255
1	001020-00	EA	1.00	1.00	0.00
	DMT HRDW PEM NUT FLOATING 6-32 SS				
2	99-0001-00	EA	1.00	1.00	0.00
	MISC REPAIR				
3	59-0080-00	EA	1.00	1.00	0.00
	DMT ELEC ASSY SOLENOID FILTR WHEEL 41344				